


This new version replaces all previous versions. Please replace SI-130115

**Weak performance, vehicle in fail-safe mode
Indicator lights for ESP and MIL are turned on
Waste gate is stuck or moves only with difficulty**

Please check if the modified **engine control unit software DAS version 10/09** is already installed when installing a new turbocharger.

If the new software version has not been installed, please install it now.

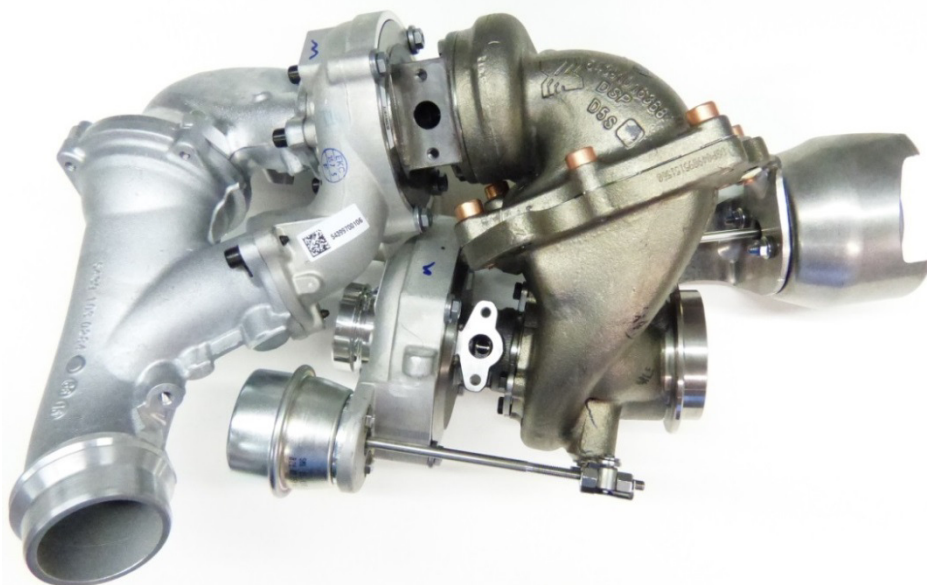

Up to engine number xxx31794909 the connection of the air pipe on the compressor may have changed. Therefore, you may need the following parts from OE in order to be able to install the new turbocharger

A 906 528 50 82	air pipe	A 651 096 29 40	bracket
A 906 501 14 82	coolant pipe	A 651 096 30 40	bracket
N 910 143 006 002	screw M6X20 (10x)		

Vehicle Manufacturer: MERCEDES-BENZ

Vehicle: SPRINTER

Engine Code: OM 651.957

Validity: This service information is valid for the exchange of the turbocharger with **BTS reference** T915834,

manufacturer part no.: 10009700008, 10009700036, 10009700074, 10009880008, 10009880036, 10009880074; **OE-no.:** A6510900880, A6510906080, A6510906380, A6510905480, A651090608018, A651090608080, A6510902280, A6510904780, A6510904880, A6510905280

Please note:

OE-references are only for means of comparison.

The content of this Service Information is non-binding and is only for informational purposes.

The manufacturer specifications have to be adhered to.