


SI-150817

Service Information Turbolader

Lack of performance, whistling noises right after installation

When installing this turbocharger, please pay close attention that the gasket between exhaust manifold and turbocharger is installed correctly.

This gasket can easily be installed in the wrong position as shown in the right pictures. This will lead to a lack of performance of the turbocharger as well as whistling noises.

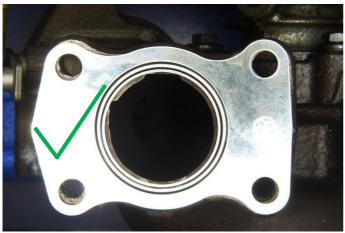



Vehicle manufacturer: PEUGEOT; CITROEN; FIAT; LANCIA

Vehicle: 806; EXPERT; C8; EVASION; JUMPY; XSARA; ULYSSE; SCUDO; ZETA; PHEDRA

Engine code: RHM; RHR; RHT; RHW; RHX; RHZ

Validity:

This service information is valid for the exchange of the turbocharger with **BTS-Nr**.: T912056; T912056BL; T914207; / T931145ABS **BTS-Service-Set:** T981119; T981119BL; T981071; T981074 **manufacturer part no:** 706978-5001S; 713667-5001S; 713667-5003S; **OE-no.:** 0375E6; 0375E7; 9634521180; 71723507; 9634584280; 0375G0; 9644384180; 71784463; 9637861280; 71723513; 9644384280; 0375F9.

Please note:

OE-references are only for means of comparison.

The content of this Service Information is non-binding and is only for informational purposes. The manufacturer specifications have to be adhered to.



