

Visually identical turbochargers with the same electrical connection must be checked for the correct version number

Introduction:

In the course of model changes and facelift introductions, the vehicle manufacturer installed turbochargers with different controls. Errors can appear in the manufacturers' spare parts lists because mixed installations have occurred.


Note:

The most important distinguishing feature is the vehicle registration under Euro 4 or Euro 5. The turbocharger show externally no difference and in addition also have the same electrical connector on the actuator. If the wrong turbocharger is installed, the electronic component will malfunction and be damaged.

When installing the wrong turbocharger or replacement of the actuator immediately void the warranty.

Instructions:

Before filling the first fill additive or installing the turbocharger, compare the version number on the nameplate with the numbers on the old part.

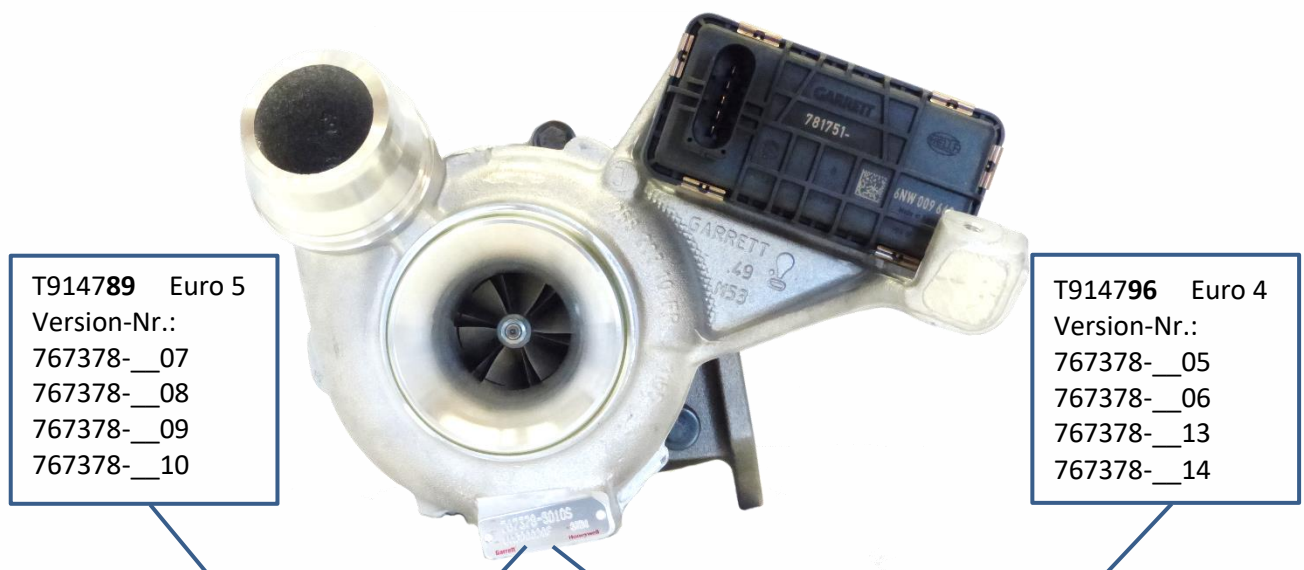

T914789 Euro 5
Version-Nr.:
767378-__07
767378-__08
767378-__09
767378-__10

T914796 Euro 4
Version-Nr.:
767378-__05
767378-__06
767378-__13
767378-__14

Vehicle Manufacturer: BMW

Vehicle: 116d, 118d, 316d, 318d, X1 18d

Engine code: N47 D20 A, N47 D20 C

Validity: This service information is valid for renewing the turbocharger with

BTS reference: T914789 **BTS-Service-Set-Nr:** T981283

OE-no.: 11652287497, 11657810189, 11657810190

Manufacturer part no.: 767378-5007S, 767378-5008S, 767378-5009S, 767378-5010S

BTS reference: T914796 **BTS-Service-Set-Nr:** T981282

OE-no.: 11652414336, 11657800594; 11657800595

Manufacturer part no.: 767378-5005S, 767378-5006S, 767378-5013S, 767378-5014S

Please note: OE-references are only for means of comparison. The content of this Service Information is non-binding and is only for informational purposes. The manufacturer specifications have to be adhered to.