

# SWAG 33 10 3603, 33 10 3573

To fit:  
various Audi and Volkswagen models  
with V6 TDI engine

**SWAG**<sup>®</sup>

EN

## Intake manifold with swirl flap actuator and gasket

### Problem

The engine performance and drivability is poor, and the engine warning lamp is illuminated.

### Cause

Excess carbon build-up in the inlet manifold prevents the swirl flaps from opening or closing completely. This puts unnecessary strain on the linkage and actuator, leading to a broken or worn linkage. As a result, the actuator operates out of its designed tolerances and the following fault code is logged in the engine control unit: P2015 - intake manifold flap position/signal improbable.

### Solution

For this repair, SWAG provides a combined kit containing the inlet manifold, gasket and swirl flap adjustment motor and linkage for each manifold. Following the successful completion of the replacement, the swirl flap system has a 'learning' procedure take place - for this, a suitable diagnostic tool is required.

For more technical information please visit: [partsfinder.bilsteingroup.com](https://partsfinder.bilsteingroup.com)