



LuK Service Info



Grinding noises from the clutch

Clutch and accessory release lever not compatible

Manufacturer: Mercedes Benz

Model: Bus Tourismo

Model year: 2003-

Part no.: 643 3315 00
643 3453 00

See parts catalogue for current assignment



Figure 1: Material loss on the rivets due to incorrect release lever

In some cases, grinding noises from the bell housing may occur after replacing the clutch on the vehicle model specified above.

The cause of the complaint is insufficient clearance between the release lever and the clutch. The release lever rubs against the clutch cover and wears away material on the rivets of the adjusting unit (Figure 1).

The complaint only occurs with accessory release levers. That is why, when installing the LuK RepSets specified above, it is essential that these are only combined with the original release levers from the vehicle manufacturer.

Please observe the vehicle manufacturer specifications!

You want more? We can help!

Phone: +44 (0) 1432 264 264

Fax: +44 (0) 1432 375 760

aftermarket.uk@schaeffler.com

www.repxpert.co.uk

SCHAEFFLER
REP>XPERT