



# AUTOELECTRO

Since 1986


## STARTER MOTORS & ALTERNATORS

**IMPORTANT PLEASE READ THE INFORMATION BELOW BEFORE FITTING THIS PART AS THERE ARE KNOWN ISSUES WHICH WILL RESULT IN THE PREMATURE FAILURE OF THE UNIT AND MAY INVALIDATE YOUR WARRANTY**


The vehicle to which this alternator is fitted has a known fault which results in the premature failure of the clutch pulley and/or bearings. The premature failure can be caused due to excessive load being exerted to the alternator pulley and bearings.

It is recommended that the belt is replaced with a **7PK1785** and a guide pulley is removed. By carrying out this modification the pressure applied to the components is reduced.

ORIGINAL BELT ROUTING

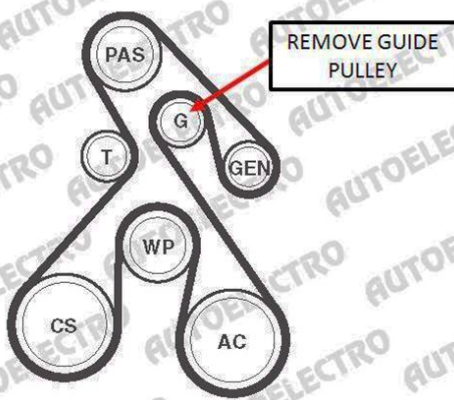

MODIFIED BELT ROUTING

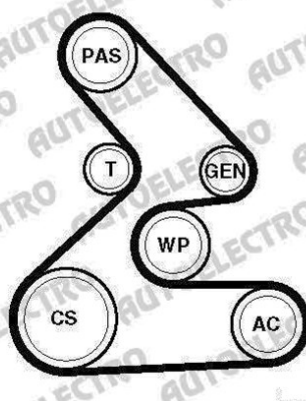

Failure to carry out the above modification can cause premature failure of the replacement alternator and may invalidate your warranty.

**FREE** vehicle specific technical information is available by visiting [autoelectro.co.uk](http://autoelectro.co.uk) OR scan this QR code



The Original and Best  
**Since 1986**