

CRITICAL INSTRUCTIONS

Application: **Isuzu Trooper 3.0LD**

Part Number:
VICF
VF430015
VL430015

WHEN FITTING THIS TURBO, IT IS **CRITICAL** THE FOLLOWING INSTRUCTIONS ARE ADHERED TO:

- **Notice to replace Oil Strainer Gaskets**

Isuzu engine modification to be carried out to prevent turbocharger failure

Due to the hardening of a flexible gasket on the oil suction pipe to strainer in the sump, the oil pump draws a mixture of air and oil causing a reduction in oil pressure. This causes damage to the turbo.

The modification only needs to be carried out once. The upgraded Isuzu part number is 8971377980

The sump must be removed to perform the modification. Before refilling the sump after the work is complete, it is important to allow the sealant sufficient time to set. Failure to do so could result in sealant entering the turbocharger oil galleries, causing serious damage.

Any questions regarding the above should be directed to the supplier of this unit before commencing any work

