SI-161205

Service-Information Turbocharger



Modified compressor housing and charge pressure hose

Introduction:


The vehicle manufacturer has made a technical change to the compressor housing, which necessitates the use of a modified charge pressure hose. Here, the cross-section dimension of the hose has changed.

Note:

If a turbocharger 5303 988 0053 without an integrated silencer has previously been installed, the following components are to be procured at OE for the installation of the new turbocharger.

Instructions:

When installing the turbocharger, ensure that the prop is correctly installed between the turbocharger and the engine block. Otherwise, the flange connection to the exhaust manifold can be released.

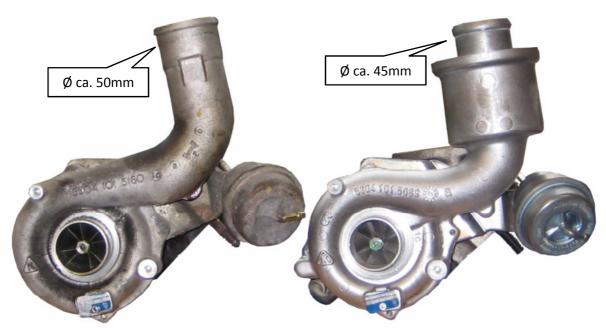

obsolete 5303 988 0053

current 5303 988 0052

Vehicle Manufacturer: AUDI, VW, SEAT

Vehicle: A3 (8L1), TT (8N3, 8N9), GOLF V (1J1), BORA (1J6), BEETLE (9C1, 1C1),

IBIZA iV (6L1), POLO (9N)

Engine code: 1.8 T, AUM, AUQ, ARY, ARX, AWV, AVC, APH, BBU, BLZ, BKV

Validity: This service information is valid for renewing the turbocharger with BTS-Service-Set-Nr: T981214, T981215, T981216 T912181

Manufacturer part no.: 53039700052, 53039700053, 53039700058, 53039700094, 53039880052,

53039880053, 53039880058, 53039880094

Please note: OE-references are only for means of comparison. The content of this Service Information is non-binding and is only for informational purposes. The manufacturer specifications have to be adhered to.

Tel.: +43 512 214220 Mail: info@bts-turbo.at Web: www.bts-turbo.at