



LuK Service Info

Part Nr. 230 0022 11 – 280/295mm TGU6

Manufacturer: STEYR

Model: 80 SERIES

Art.-Nr.: 230 0022 11



TB1043

Info: New product / Neues Produkt /
Nouveau produit / Nuevo producto /
Nuovo prodotto



POWER TAKE OFF CLUTCH NOISE AND RELEASE
PROBLEMS.



RUIDO DEL EMBRAGUE DE LA TOMA
DE FUERZA Y PROBLEMAS DE LIB-
ERACIÓN.




KRAFTABGANG, KUPPLUNGSGERÄUSCH UND
LÖSEPROBLEME.



PRESA DI FORZA RUMORE DELLA
FRIZIONE E PROBLEMI DI RILASCIO.



BRUIT D'EMBRAYAGE DE PRISE DE FORCE ET PROBLÈMES
DE RELÂCHEMENT.

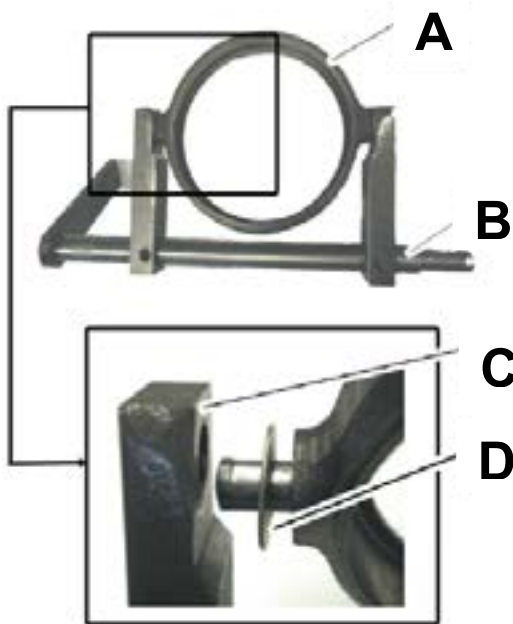

A - Release bearing carrier
B - Actuation shaft
C - Release fork arm
D - Thrust washer

Excessive or uneven wear to the release bearing carrier pivots can result in failure or breakage of the PTO release bearing. Prolonged use in this condition can damage the PTO clutch release plate and levers. Uneven release movement of the clutch pressure plates causes noise and vibration. All areas of wear need to be addressed when replacing the clutch assembly.



Call : +44 (0) 1432 264264
vehiclelifesolutions.schaeffler.com

SCHAEFFLER
REP>XPERT