
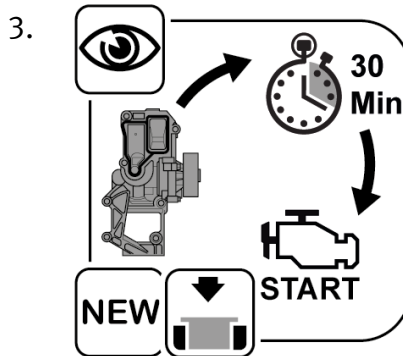
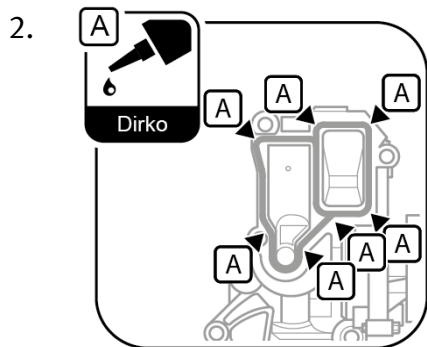
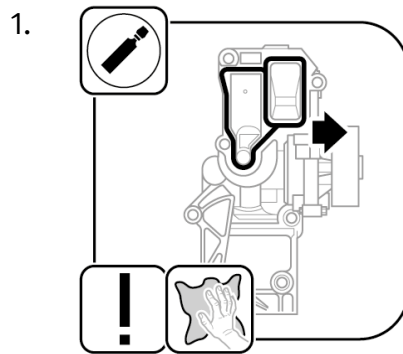


## Repair solution for the water pump gasket

**B47.470** | Suitable for BMW | MINI

Elring offers a repair solution for the water pump gasket for BMW engines B32 S15 A, B38 A15 A, B42 S20 A, B46 A20 B, B48 A20 A, and B48 A20 B. This avoids having to replace the entire water pump.

The old gasket is first removed using a suitable tool. Before installation, make sure that the surface is clean and free from residue. Sealing compound points (see Figure no. 2) must be applied to ensure that the gasket remains in the correct place during installation. To ensure that the EPDM gasket functions perfectly, you should wait 30 minutes after installation.

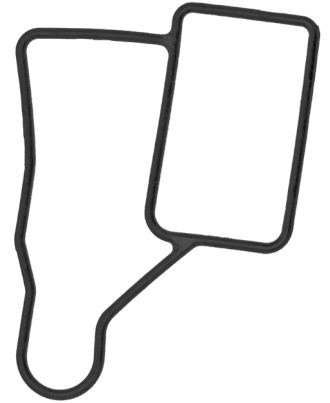

471.501 | 006.553

**ElringKlinger AG | Aftermarket Division**

Max-Eyth-Straße 2 | 72581 Dettingen/Erms | Germany

Phone +49 7123 724-799

service@elring.com | www.elring.com

TS1 09/2025



**Das Original**