

TECHNICAL

BULLETIN

**TECH
MATE**

Bulletin Ref: TB22a

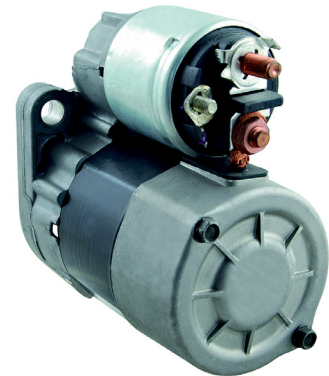
Nissan Micra K12

ASM1524

A known fault on the K12 Nissan Micra can result in incorrect diagnosis of a fault with the starter motor.

If the starter motor is not engaging when the ignition key is turned this is often due to a fault with the vehicles main fuse board, changing the starter motor relay does not fix the problem.

The fuse box needs replacing and also coding to the vehicles ECU.

**TECH
MATE**

For further information on this or any other issue contact the
Apec technical team by phone or email at:
Phone: 01174 288090 Email: technical@apecautomotive.co.uk



FOLLOW US
#TechMate | @TechMateAuto