



High pressure pump PTA441-0001

TECHNICAL INFORMATION ON INSTALLATION

ATTENTION!

A run-in or worn roller tappet (OE no.: 06L 109 311) of the high-pressure pump can cause, among other things

1. noises,
2. uneven engine running and
3. error messages [e.g. P0087; P2293]

although the high-pressure pump is fully functional.

PartsTec specifies the replacement of the roller tappet, PTA120-0043, when replacing the high-pressure pump.

The roller tappet must always be checked for wear during the repair. There is no additional work.

When working on the fuel system, the respective specific repair instructions and cleanliness rules of the vehicle manufacturer must be observed.


PartsTec also offers the repair kit, high-pressure pump PTA441-3000.



PTA441-0001



PTA120-0043

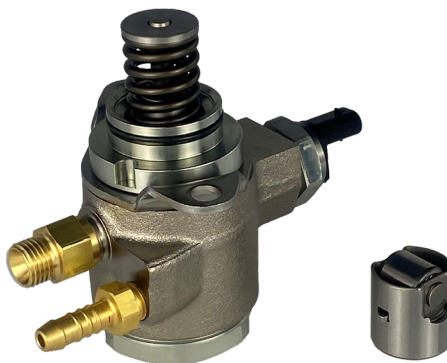

Repair kit PTA441-3000

In the event of a warranty claim, a proof of the renewed roller tappet and a fault memory log must be enclosed.