



# KNOW HOW

## TECHNICAL BULLETIN




### NSM1524 - Nissan Micra K12

Bulletin Ref: TB22n

A known fault on the K12 Nissan Micra can result in incorrect diagnosis of a fault with the starter motor.

If the starter motor is not engaging when the ignition key is turned this is often due to a fault with the vehicles main fuse board, changing the starter motor relay does not fix the problem.

The fuse box needs replacing and also coding to the vehicles ECU.

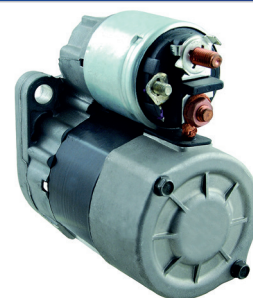

## Technical Support

Contact our expert technical team  
on 03333 136597 or email  
[NAPATECHNICAL@allianceautomotive.co.uk](mailto:NAPATECHNICAL@allianceautomotive.co.uk)



## TechMate Support

Book a TechMate visit today!  
Contact the team on 01174 288090  
or email [info@techmateteam.co.uk](mailto:info@techmateteam.co.uk)