Product info sheet | Denso | DCRI106130
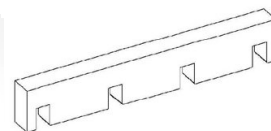
Special tools needed?	Yes

EN-48560

Align injectors
Attention: Exchange injectors have a new ID code on the body, use this instead of the original.

Product specific information

Programming	Yes	ID code (22 characters)
Unlocking	No	
Adaption values reset	No	
Bleed	No	
adjustment at mounting_1	No	
adjustment at mounting_2	--	

Tightening torques

Injector/ retainingclamp	40 Nm, loose 2 turns, 32 Nm
High Pressure pipe nuts	25 Nm
Bolts valve cover	10 Nm

Assembly instructions

Replace sealing washer

Replace tension bolts

Recommendation: replace gasket valve cover

Core charge terms:
-externally intact,
-no mechanical damage,
-not dismantled,
-no heavy corrosion.