


## MDB4141

As the inner and outer pads for the references associated with WVAs 22485 / 22486 are extremely similar, we would like to give you some support to help identify which of the pads are for inside or for the outside.

As you can see from the drawings below some fixation pips are located further apart on one brake pad (22486), while the pips are closer together for the other pad (22485).

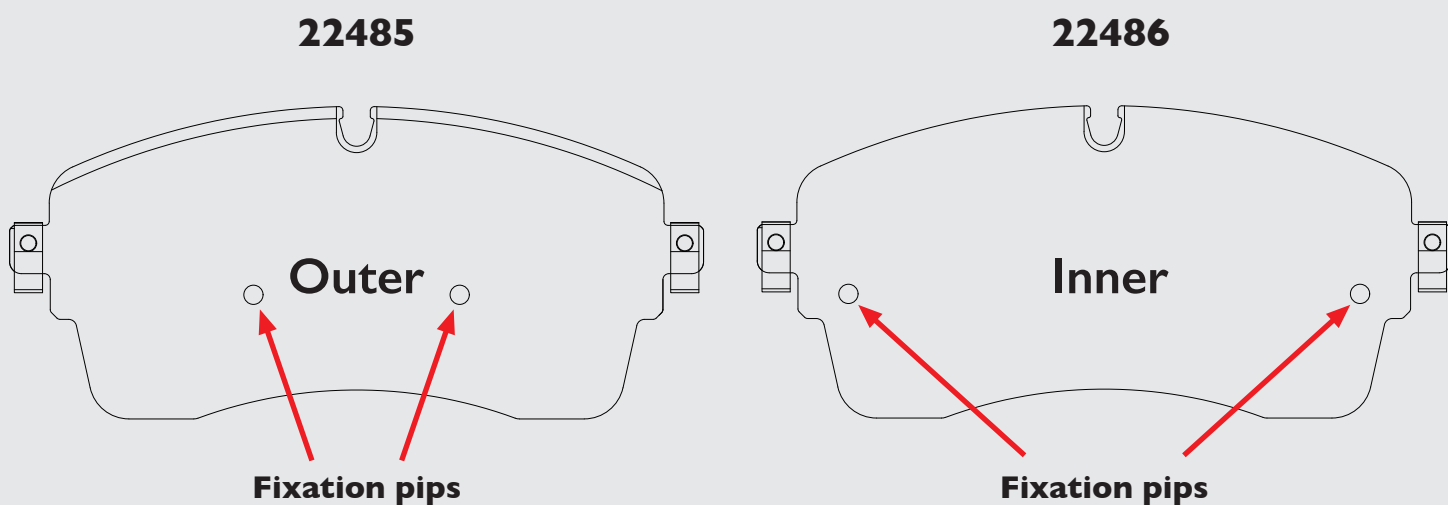

Due to these different locations of the pips, the parts are not interchangeable in the caliper. WVA 22485 is for the outer side, 22486 is for the inner side. Swapping the sides of these parts would cause the piston or respectively the fingers of the caliper to push against the pips. This could result in noise issues or an uneven wear of the friction material.

Therefore, please look at the brake pads carefully to ensure that they are not mixed up prior to assembly.