

Product info sheet

Robert Bosch

0414720454

Special tools needed?

No

Product specific information

Programming

No

Unlocking

No

Adaption values reset

No

Bleed

No



adjustment at mounting_1

Yes

4 cyl: cam on top, adjusting screw clockwise to stop, anticlockwise 180°

adjustment at mounting_2

--

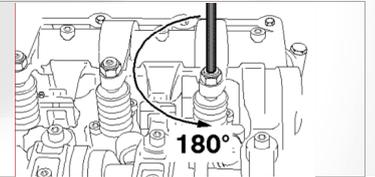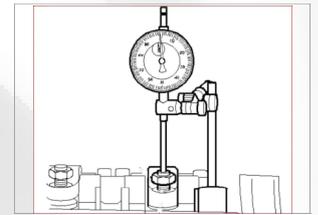

Tightening torques

Injector/ retaining clamp

3 Nm + 90° + 180°

Locknut adjusting screw

30 Nm

Bolts rockershaft

20 Nm + 90°

Bolts valve cover

10 Nm

Assembly instructions

Replace tension bolts

Replace adjusting screw rocker

Replace bolts rockershaft

Conical fitting; no sealing washer required

Core charge terms:

- externally intact,
- no mechanical damage,
- not dismantled,
- no heavy corrosion.