



CLUTCHTECH



TSB - SU02

It's common for this vehicle to develop excessive wear on the nose cone (bearing slide) on the transmission. Check the nose cone visually for wear before fitting the new bearing.

Symptoms of a worn nose cone:

- Clutch Pedal Vibration
- Notchy Pedal
- Hard/ Heavy Pedal


If your vehicle exhibits any of these symptoms or visually shows wear, ClutchPro recommends fitting a repair sleeve kit. There are 2 kits available depending on the clutch fork in the vehicle. Measuring the outside width of the fork prongs as illustrated below will give a result of 68mm or 82mm.



Repair kit required based on measurement:
68mm: TB33010-SLV
82mm: TB33045-SLV



youtube.com/watch?v=sBsZhQQa9BQ

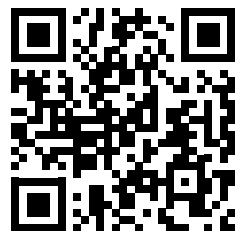

Scan with a QR app on your smart phone

LEADING BRANDS

CLUTCHPRO CLUTCHPRO



australianclutch.com.au

1800 CLUTCH (258824)